


FIAT Ducato 35 LWB HR: 438ASZ

Vinnumber:	ZFA25000001615754	Versionname:	DUCATO 35 B/F LWB HR
First Registrationdate:	9/07/2009	Fiscalpower:	120pk
Expertise Mileage:	268544	Power Kw:	88
Bodytype:		Body color	White
Gearbox:	MAN 6 VIT	Paint type	Opaque
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	LCV05
Number of doors	5		
Number of seats	6		
Number head rests	6		
Rims summer	Steel		
Category	Light Commercial Vehicle		
Oil level	OK		

Options

Radio CD	Central consol F
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining artificial leather

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	215/70/15/109 S Steel			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Uniroyal: 4 mm	Re.R.	Uniroyal: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 2974,73

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Damaged, LI - Repair and paint (complete) 165,13



Dashboard, Hole, Smart repair 110,64



Sill outer R, Bump(s) and scratch(es), LI - Repair and paint (complete) 232,88



Trunk door R R, Bump(s) and scratch(es), It - Spot repair 115,56



Bumper F R, Scratch(es), Smart repair 110,64



Rearlight R , Broken, E - Replace 91,50



Mirror side blinker L, Broken, E - Replace 28,50



Roof, Damaged, LI - Repair and paint (complete) 361,13



Sill outer L, Bump(s) and scratch(es), It - Spot repair 115,56



Door moulding Lower F L, Missing, E - Replace 91,50



Electricity circuit, Not functioning (well), P - Check 0,00



Bonnet, Damaged, LI - Repair and paint (complete) 217,56



Interior, Dirty, Acceptable 0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete) 238,76



Seat cover F L, Burned, Smart repair 64,32



Lock stricker R, Not functioning (well), E - Replace 115,50

No pictures to display

Wing R L, Bump(s) and scratch(es), It - Spot repair 115,56



Bodywork, Not original part, Sticker removal 0,00

No pictures to display

Tailgate, Bump(s) and scratch(es), Le - Replace and paint 799,99

