



VOLKSWAGEN Touran: 1FOD481

Vinnnumber:	WVGZZ1TZEW018566	Versionname:	TOURAN Trendline BMT Start/Stop 105PK
First Registrationdate:	4/09/2013	Fiscalpower:	
Expertise Mileage:	181493	Power Kw:	77
Bodytype:	Hatchback	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2301
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 MS LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------


Total cost ex VAT	1350,86
-------------------	---------

Door R L, Bump(s) and scratch(es), It - Spot repair	115,56
---	--------



Wing F R, Bump(s), LI - Repair and paint (complete)

268,18

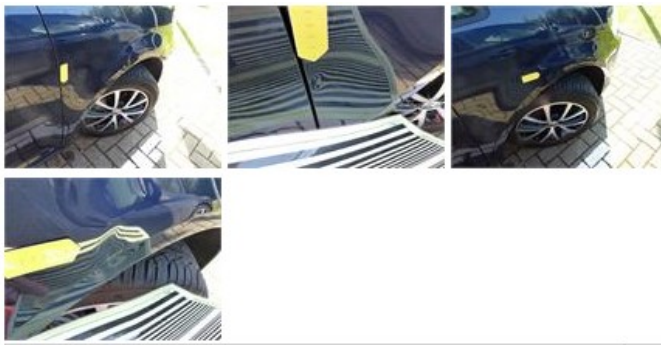

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door R L, Bump(s), Acceptable 0,00

No pictures to display

Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Bump(s) and scratch(es), It - Spot repair 115,56



Wing R R, Bump(s), LI - Repair and paint (complete) 356,20



Door F R, Bump(s), Acceptable 0,00

No pictures to display

Rearview mirror L complete, Broken, E - Replace 168,00



Door F L, Bump(s), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F R, Bump(s), LI - Repair and paint (complete) 115,56

