



VOLKSWAGEN Touran: 1FDR641			
Vinnnumber:	WVGZZZ1TZDW096887	Versionname:	TOURAN Trendline BMT Start/Stop 105PK
First Registrationdate:	3/06/2013	Fiscalpower:	
Expertise Mileage:	145532	Power Kw:	77
Bodytype:		Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3301
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Sun Roof electric	
GPS storage	HD	Panoramic roof	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/55/16/91 H LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Dunlop: 5 mm	Re.R.	Dunlop: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			4253,09
Alloy rim R R polished, Scratch(es), E - Replace			235,20



Door F R, Bump(s), PDR - Knock out without painting	178,80
--	---------------



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Damaged, E - Replace 235,20



Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Central pillar L, Bump(s), It - Spot repair 115,56



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door panel F L, Scratch(es), Smart repair 110,64



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 338,08



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80





Alloy rim F R polished, Damaged, E - Replace 235,20



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18



Rear window, Scratch(es), E - Replace 370,00



Cigar lighter, Not functioning (well), E - Replace 18,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Glove compartment lid, Scratch(es), Smart repair 110,64



Front bumper, Damaged, Le - Replace and paint 735,00



Wing F L, Scratch(es), LI - Repair and paint (complete) 208,20

Wing R L, scratch(es), Lt - repair and paint (complete)

300,20



Door frame R R, Bump(s) and scratch(es), lt - Spot repair

115,56

