


NISSAN QASHQAI+2: ET5701

Vinnumber:	SJNJCAJ10U7190021	Versionname:	1.5 DCI EXECUTIVE 2WD
First Registrationdate:	22/10/2013	Fiscalpower:	
Expertise Mileage:	168735	Power Kw:	81
Bodytype:	SUV	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Panoramic roof	
GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/18/99 V LightMetal				
Summer tyres:	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1290,48
Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door panel R L, Tear, Smart repair

110,64




Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Rear window, Scratch(es), E - Replace

370,00

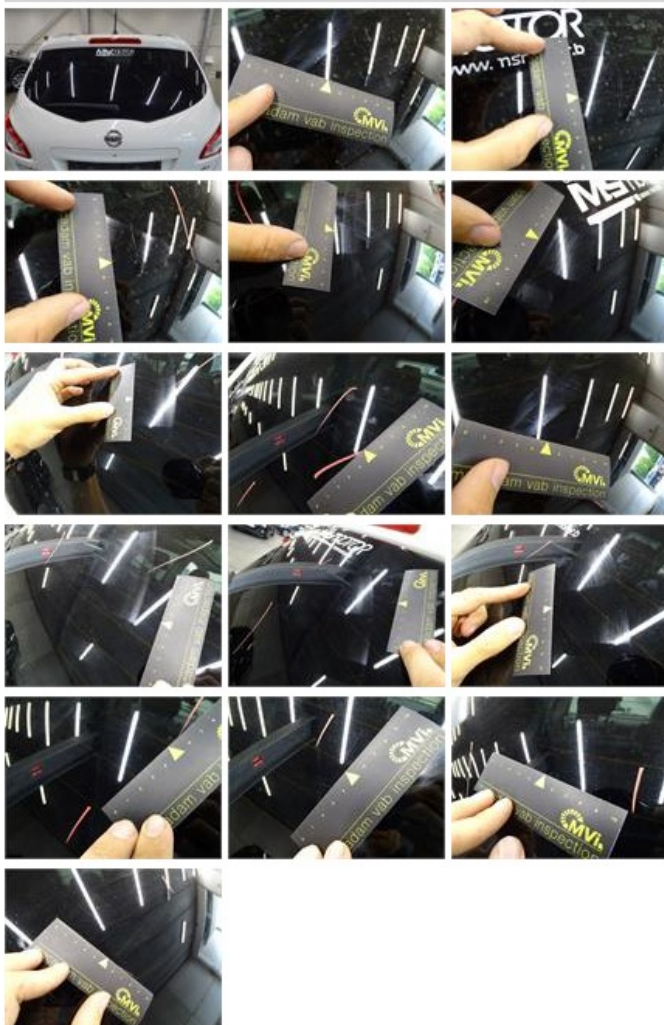

Outer backrest protection R, Tear, Smart repair

110,64



Protection plate M, Deformed / Strained, E - Replace

74,00



Bumper cover R M, Scratch(es), Smart repair

110,64



Rearlight L, Waterinfiltration, E - Replace

114,00



Rocker panel inner R R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56





Door R R, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Rust, Acceptable 0,00

