



MERCEDEZ VITO: YIC872

Vinnumber:	VSA63819413203052	Versionname:	
First Registrationdate:	10/05/1999	Fiscalpower:	90
Expertise Mileage:	241750	Power Kw:	
Bodytype:	Transporter	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV06
Number of doors:	4		
Number of seats:	2		
Number head rests:	2		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	Type of Tow bar
Radio multimedia	Tow bar fixed
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/65/15/102 T Steel				
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Continental: 8 mm	Re.R.	Continental: 8 mm

Assistance equipment

Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2689,10
Roof, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)	362,02



Ignition key, Missing, E - Replace 150,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 22,50



Floor covering F L, Hole, Smart repair 64,32



Door panel F L, Worn, Acceptable 0,00




Door F L, Rust, LI - Repair and paint (complete) 238,76



Internal Boot Lining R, Tear, Smart repair 110,64



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 238,76

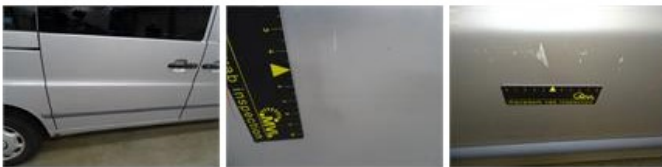



Internal Boot Lining L, Tear, Acceptable	0,00
No pictures to display	
Switch window control F R, Missing, Repair/replace (lump sum)	0,00
No pictures to display	
Wing F L, Rust, Acceptable	0,00
No pictures to display	
Trunk lid covering R, Tear, Smart repair	110,64



Wing F R, Scratch(es), Acceptable	0,00
No pictures to display	
Bumper F, Scratch(es), Acceptable	0,00
No pictures to display	
Bonnet, Dent(s), Acceptable	0,00
No pictures to display	
Rearlight R , Crack, E - Replace	91,50



Wheel cover R R, Deformed / Strained, E - Replace	22,50
---	-------



Seat cover F L, Worn, Acceptable	0,00
----------------------------------	------



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	231,15
---	--------



Radio, Not original part, Acceptable 0,00

No pictures to display

Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 232,88



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 238,76



Bumper R, Scratch(es), Smart repair 110,64





Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 232,88



Switch window control F L, Missing, Repair/replace (lump sum) 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

