


VOLKSWAGEN TIGUAN: 1FWY761

Vinnnumber:	WVGZZZ5NZEW551368	Versionname:	TIGUAN Sport&Style BM Tech.140PK
First Registrationdate:	22/11/2013	Fiscalpower:	
Expertise Mileage:	118056	Power Kw:	103
Bodytype:		Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3804
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	HD	Seats electric F R	
GPS storage		Sun Roof electric	
Windows electric F		Panoramic roof	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Type of headlighting	Headlighting Halogen	Rear parking sensors	
Type of GPS	GPS big screen color	Type of Tow bar	Tow bar removable
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/55/17/99 V LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			3336,37
Wing trim R L, Scratch(es), E - Replace			84,00



Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Grill frame, Broken, E - Replace 95,77



Tyre F R, Tear, E - Replace 132,00



Tailgate, Dent(s), LI - Repair and paint (complete) 397,68



Door moulding Lower R R, Damaged, E - Replace 114,00



Wing trim R R, Scratch(es), E - Replace 84,00



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Bumper R, Scratch(es), E - Replace

415,20



Air vent R M, Broken, E - Replace

156,00



Wing R L, Dent(s), PDR - Paintless dent repair

82,80



Wing moulding F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Bumper corner R L, Scratch(es), It - Spot repair

115,56



Door R R, Dent(s) and scratch(es), Le - Replace and paint

946,92



