



<b>VOLVO V60: 1EHW126</b>			
Vinnumber:	<b>YV1FW84A1D1117942</b>	Versionname:	<b>V60 D2 Kinetic St/St 115PK</b>
First Registrationdate:	<b>7/12/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>180626</b>	Power Kw:	<b>84</b>
Bodytype:	<b>Break</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3830</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>			
Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Rear parking sensors	
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining semi-leather</b>		
Type of climate control	<b>Autom climate control</b>		

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Sound engine	<b>OK</b>
Idle position	<b>OK</b>	Clutch test	<b>OK</b>
Engine startingtime	<b>OK</b>	Wiper fluid level	<b>OK</b>
Exhaust gass	<b>OK</b>	Lighting	<b>OK</b>
Transmission	<b>OK</b>	Wiperblades	<b>OK</b>
Handbrake	<b>OK</b>		

<b>Degree of wear</b>				
	<b>225/45/17/91 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 2 mm</b>	Fr.R.	<b>Michelin: 2 mm</b>
	Re.L.	<b>Michelin: 3 mm</b>	Re.R.	<b>Michelin: 3 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT			<b>1501,86</b>
Bumper R, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Bumper grille, Damaged, Acceptable			<b>0,00</b>



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	<b>95,00</b>
--	--------------



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80




Rear window, Scratch(es), Acceptable 0,00



Seat cover F L, Stain, Forfeit 12,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

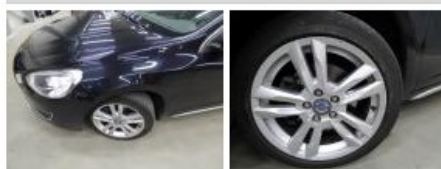

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Headlight L, Scratch(es), E - Replace 396,00



Sill trim R, Scratch(es), It - Spot repair 115,56



Door panel R L, Damaged, Acceptable 0,00



Alloy rim R R, Scratch(es), Acceptable

0,00

*No pictures to display*