



MERCEDDES C: 1ENF787			
Vinnnumber:	WDD2042001G069779	Versionname:	C BRE 180 CDI BlueEFF. S&S 120PK
First Registrationdate:	29/01/2013	Fiscalpower:	
Expertise Mileage:	169844	Power Kw:	88
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1425
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining leather
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Fulda: 6 mm	Re.R.	Fulda: 6 mm

Assistance equipment	
Total cost ex VAT	2465,73
Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80



Wing F L, Chemical polution, Acceptable	0,00
<i>No pictures to display</i>	
Rear window, Scratch(es), E - Replace	370,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display


Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Damaged, E - Replace 487,20



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50

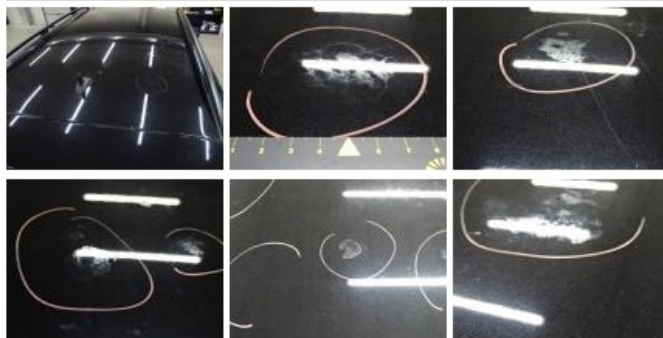

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display