


BMW 5: 1CLZ500

Vinnumber:	WBAMX11020C973572	Versionname:	5 TOURING 520d 163PK
First Registrationdate:	2/01/2012	Fiscalpower:	
Expertise Mileage:	86850	Power Kw:	120
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	2315
Maintenance:	- 6000km		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F
GPS storage	HD	Luggage cover
GPS storage		Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	225/55/17/101 V LightMetal			
Winter tyres:	Fr.L.	Semperit: 6 mm	Fr.R.	Semperit: 6 mm
	Re.L.	Semperit: 5 mm	Re.R.	Semperit: 5 mm

Assistance equipment


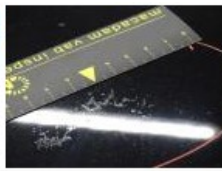





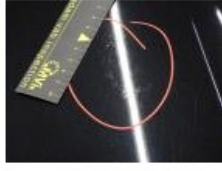

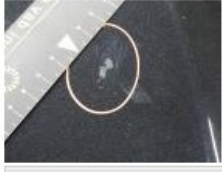











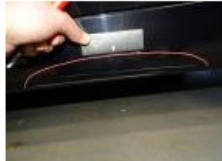
Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	3158,51
-------------------	---------

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Roof, Chemical pollution, LI - Repair and paint (complete)	577,80
--	--------

			Ceiling, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>				
			Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>				
			Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
			Bonnet, Chemical polution, LI - Repair and paint (complete)	348,09
			Tailgate, Bump(s) and scratch(es), Acceptable	0,00
				<i>No pictures to display</i>
			Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
			Maintenance, Maintenance, Execute	0,00
<i>No pictures to display</i>				
			Windscreen, Damaged, E - Replace	560,64
		Internal Boot Lining L, Incomplete, E - Replace		
				95,00
		Interior, Smell, Ozone treatment		
				152,58
			Window F L door, Not functioning (well), I - Repair	0,00
<i>No pictures to display</i>				
			Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>				
			Sill outer L, Scratch(es), LI - Repair and paint (complete)	372,60
				

Bumper R, Crack, Le - Replace and paint

766,80



Door F L, Repaired, Acceptable

0,00

No pictures to display