



VOLKSWAGEN TOURAN: 1DQ0707

Vinnumber:	WVGZZZ1TZDW015158	Versionname:	
First Registrationdate:	24/07/2012	Fiscalpower:	
Expertise Mileage:	337725	Power Kw:	77
Bodytype:	MPV	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3402
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F
GPS storage	HD	Rear parking sensors
GPS storage		
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Dunlop: 6 mm	Fr.R.	Dunlop: 6 mm
	Re.L.	Pirelli: 4,5 mm	Re.R.	Pirelli: 4,5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 2078,02

Console storage compartment, Crack, E - Replace 69,00



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Bump(s), PDR - Knock out without painting 63,00



Windscreen, Stone chip(s), Windscreen repair 88,20



Boot carpet, Waterinfiltration, Cleaning 0,00




Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Internal Boot Lining R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Stain, Cleaning 125,00

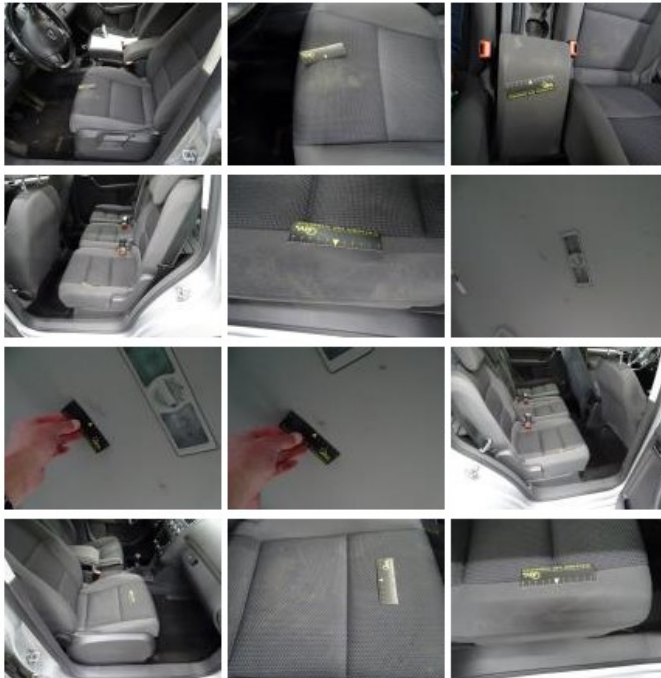

Cupholder R, Broken, E - Replace 57,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door frame R L, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Rust, Acceptable	0,00
<i>No pictures to display</i>	
Tailgate, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Trunk lid covering R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R polished, Scratch(es), E - Replace	235,20



Ceiling, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Missing, E - Replace	97,00



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------



Luggage space cover, Missing, E - Replace	240,00
---	--------



Alloy rim F R polished, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F L, Bump(s) and scratch(es), Le - Replace and paint	530,02

