



MERCEDES A: 1LR5655

Vinnnumber:	WDD1760121V118207	Versionname:	1.5 A 180 D
First Registrationdate:	17/11/2015	Fiscalpower:	BLUEEFFICIENCY EDITION
Expertise Mileage:	69562	Power Kw:	80
Bodytype:		Body color:	Light Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1727
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	NOT OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Goodyear: 3 mm	Fr.R.	Goodyear: 3 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1178,53
-------------------	----------------


Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------




Seat cover F R, Dirty, Cleaning	25,00
---------------------------------	--------------





Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)	211,80
---	---------------

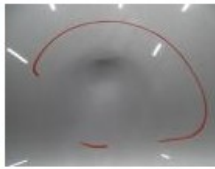

Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20

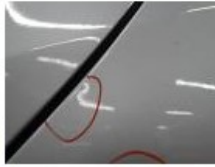

Roof pillar R, Bump(s), LI - Repair and paint (complete) 220,18

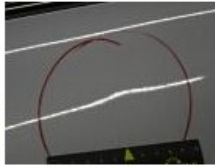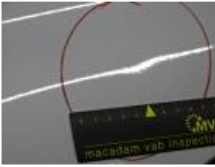

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35

