


**AUDI A6: 1HFY176**

Vinnnumber:	<b>WAUZZZ4GXEN173993</b>	Versionname:	<b>A6 AVANT Multitr.136PK</b>
First Registrationdate:	<b>10/07/2014</b>	Fiscalpower:	<b>Aut.</b>
Expertise Mileage:	<b>84806</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Grey</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3230</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	<b>HD</b>	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	<b>Headlighting Xenon</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining leather</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		

**Degree of wear**

	<b>225/55/17/97 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Goodyear: 5 mm</b>	Fr.R.	<b>Goodyear: 5 mm</b>
	Re.L.	<b>Goodyear: 7 mm</b>	Re.R.	<b>Goodyear: 7 mm</b>

**Assistance equipment**

Spare tyre compact	<b>Yes</b>
Repair kit	<b>Yes</b>

Total cost ex VAT	2113,47
Rearview mirror housing L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Front bumper, Scratch(es), LI - Repair and paint (complete)	254,16



Sill outer L, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Floor covering F R, Dirty, Cleaning 25,00



Seat cover F L, Dirty, Acceptable 0,00

No pictures to display

Wing F R, Chemical polution, LI - Repair and paint (complete) 264,21



Wing F L, Scratch(es), LI - Repair and paint (complete) 264,21



Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Scratch(es), Acceptable 0,00

*No pictures to display*

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00




Windscreen, Stone chip(s), Acceptable 0,00

*No pictures to display*

Door panel R R, Scratch(es), Acceptable 0,00

*No pictures to display*

Roof, Chemical polution, LI - Repair and paint (complete) 577,80

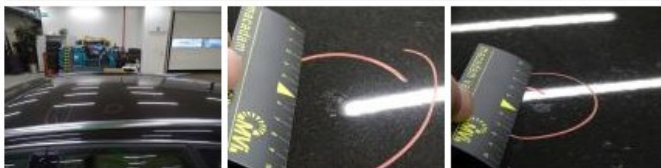

Window R L door, Scratch(es), Acceptable 0,00

*No pictures to display*