



VOLVO V40: 1JSC012

Vinnnumber:	YV1MV8481F2227971	Versionname:	1.6 D2 KINETIC
First Registrationdate:	11/02/2015	Fiscalpower:	
Expertise Mileage:	107552	Power Kw:	84
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3608
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	HD	Luggage cover
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	3188,52
-------------------	---------

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete)	318,35
---	--------





Interior, Dirty, Cleaning 25,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Bump(s) and scratch(es), Le - Replace and paint 1231,51



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80




Bumper R, Damaged, Le - Replace and paint 651,00



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50

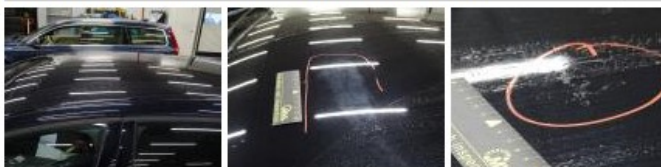

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Windscreen repair 58,80



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Bumper cover R M, Missing, E - Replace 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display