


PEUGEOT 308: 1GK1129

Vinnnumber:	VF3LB9HCGES023595	Versionname:	308 BER e-HDi Feline STT
First Registrationdate:	3/03/2014	Fiscalpower:	115PK
Expertise Mileage:	45470	Power Kw:	85
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3114
Maintenance:	21/03/2018		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage	HD	Seats electric F L
GPS storage		Seats electric F R
Windows electric F		Panoramic roof
Windows electric R		Central consol F
Cruise Control		Luggage cover
Steering wheel multifunctional		Front parking sensors
Seats F heated		Rear parking sensors
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	225/45/17/91 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1286,91
-------------------	---------

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------





Door F L, Bump(s) and scratch(es), Le - Replace and paint 0,00




Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bump(s), Acceptable 0,00

No pictures to display

Door R L, Bump(s) and scratch(es), Le - Replace and paint 0,00

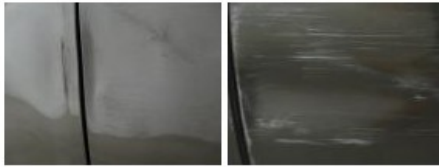

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Front bumper, Scratch(es), It - Spot repair 115,56



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	366,35
---	--------



Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

