



MERCEDES A: 1HVN948

Vinnumber:	WDD1760121V034711	Versionname:	A 180 CDI BE 109PK
First Registrationdate:	14/10/2014	Fiscalpower:	
Expertise Mileage:	92071	Power Kw:	80
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3415
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD
Windows electric F	
Windows electric R	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 7 mm	Re.R.	Uniroyal: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1362,66
Wing R L, Bad repair, Paint	0,00



Rear window, Scratch(es), E - Replace 370,00





Maintenance book, Missing, E - Replace 0,00



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08



Roof pillar L, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18



Roof, Scratch(es), Acceptable 0,00

No pictures to display

Rear spoiler, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display


Tailgate, Bump(s), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Bad repair, Paint 0,00

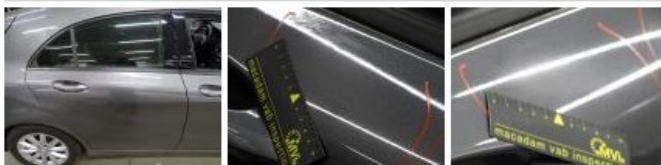

Windscreen, Stone chip(s), Windscreen repair 58,80



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80

