



FIAT Ducato 35 LWB HHR: 1AHW710

Vinnumber:	ZFA25000001882162	Versionname:	DUCATO 35 B/F LWB HHR
First Registrationdate:	13/01/2011	Fiscalpower:	120pk
Expertise Mileage:	170095	Power Kw:	88
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV29
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining artificial leather
Type of climate control	Manual climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	NOT OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	215/70/15/109 S Steel			
Summer tyres:	Fr.L.	Uniroyal: 8 mm	Fr.R.	Uniroyal: 8 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Total cost ex VAT	2272,27
Door moulding Lower R L, Damaged, E - Replace	91,50



Rearview mirror R complete, Damaged, E - Replace	138,00
--	---------------



Rearlight L, Damaged, E - Replace	91,50
-----------------------------------	--------------



Door moulding Lower R R, Damaged, E - Replace 91,50



Central pillar L, Missing, E - Replace 74,00



Rearview mirror L complete, Damaged, E - Replace 138,00



Door moulding Lower R L, Damaged, E - Replace 91,50



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Bump(s), Smart repair 110,64



Rocker panel inner F L, Scratch(es), LI - Repair and paint (complete) 115,56



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 231,15



Interior, Dirty, Cleaning 50,00



Wheel cover F L, Unclashed, Acceptable 0,00



Wheel aperture R L, Bump(s), LI - Repair and paint (complete) 246,00




Front bumper, Scratch(es), Smart repair 110,64



Wheel aperture R R, Rust, Le - Replace and paint 296,00



Roof, Bad repair, Acceptable 0,00

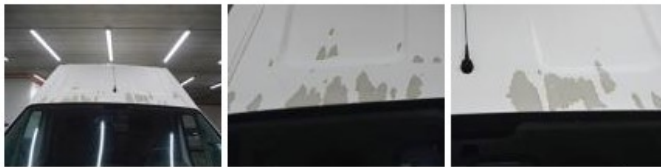

Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 231,15



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 165,13



