



VOLKSWAGEN Touran: 1GPU494			
Vinnumber:	WVGZZZ1TZEW074173	Versionname:	TOURAN Trendline BMT St&St 7pl.105PK
First Registrationdate:	27/03/2014	Fiscalpower:	
Expertise Mileage:	76582	Power Kw:	77
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2424
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		


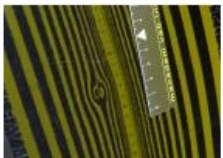

Options			
Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		



Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/60/16/96 H LightMetal			
Winter tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 8 mm	Re.R.	Continental: 8 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes

Total cost ex VAT	2310,05
Door R R, Bump(s), PDR - Knock out without painting	82,80

  	Roof, Scratch(es), LI - Repair and paint (complete)	481,50
--	--	---------------

 	Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20
---	--	---------------



Front bumper, Bad repair, Paint 0,00



Interior, Stain, Cleaning 75,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 290,08



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Cupholder R, Not functioning (well), E - Replace 35,00



Door R L, Scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68





Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Glove box cover, Scratch(es), Smart repair	110,64
--	--------



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------

