



AUDI A6: 1FEB438

Vinnumber:	WAUZZZ4G4DN146061	Versionname:	A6 AVANT 136PK
First Registrationdate:	4/06/2013	Fiscalpower:	
Expertise Mileage:	150168	Power Kw:	100
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	ONDERHOUDSBEURT BEREIKT	Parking lot:	2732
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/60/16/98 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Uniroyal: 7,5 mm	Re.R.	Uniroyal: 7,5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	2947,06
-------------------	---------

Roof rail R, Scratch(es), Acceptable	0,00
--------------------------------------	------

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)	115,56
--	--------



Door R L, Scratch(es), LI - Repair and paint (complete)	382,02
---	--------



Door F R, Bad repair, Paint 0,00



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Floor covering F L, Hole, E - Replace 264,00



Wing R R, Scratch(es), LI - Repair and paint (complete) 369,84



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Door panel F L, Scratch(es), Acceptable 0,00



Windscreen, Stone chip(s), Windscreen repair 0,00



Roof rail L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display


Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 577,80



Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09

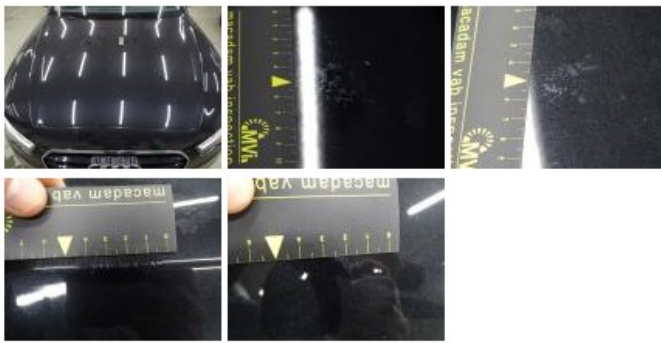

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Scratch(es), LI - Repair and paint (complete) 369,84



Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16



Rearlight R, Scratch(es), 67 - Polish 55,19

