



VOLVO V40: 1EQD366			
Vinnnumber:	YV1MV8481D203336	Versionname:	V40 D2 Base 115PK
First Registrationdate:	20/02/2013	Fiscalpower:	
Expertise Mileage:	103817	Power Kw:	84
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4103
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/55/16/91 H LightMetal			
Summer tyres:	Fr.L.	Kleber: 5 mm	Fr.R.	Kleber: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1281,91
Alloy rim F L, Deformed, E - Replace			235,20



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

Bumper F R, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F L, Dirty, Acceptable 0,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Floor covering F L, Hole, E - Replace 252,00



Seat cover R L, Stain, Cleaning 25,00




Door panel F L, Worn, Acceptable 0,00



Bumper corner R L, Scratch(es), It - Spot repair 115,56



Rear window, Scratch(es), E - Replace 0,00

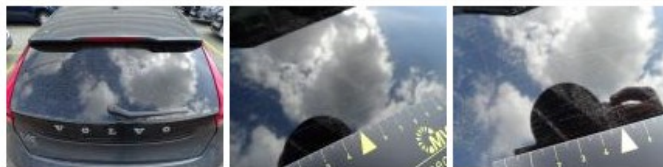

Door R L, Scratch(es), LI - Repair and paint (complete) 318,35




Windscreen, Stone chip(s), Windscreen repair 0,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Bump(s), PDR - Knock out without painting 63,00

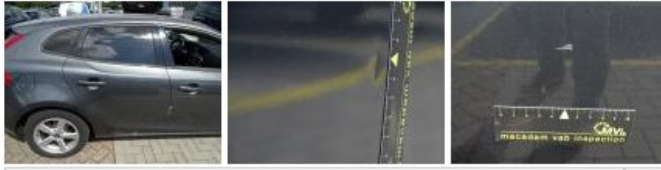

Wing R R, Bump(s), PDR - Knock out without painting 82,80

