



FORD Mondeo: 1EWM284

Vinnumber:	WF0GXXG88GCS78889	Versionname:	MONDEO CLIP Econetic Titanium 115PK
First Registrationdate:	8/04/2013	Fiscalpower:	
Expertise Mileage:	146506	Power Kw:	85
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4109
Maintenance:	GEEN BERICHT		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/16/93 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 1940,43

Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 259,80



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror basis R, Scratch(es), Acceptable 0,00



Interior, Worn, Acceptable 0,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 356,20



Bumper moulding R, Deformed, E - Replace 14,40




Wing R L, Scratch(es), Acceptable 0,00



Front bumper, Damaged, Le - Replace and paint 0,00



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50

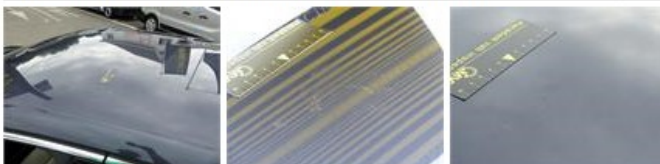

Door F L, Scratch(es), LI - Repair and paint (complete) 0,00



Interior, Dirty, Cleaning 100,00






Rear Panel Internal Lining, Scratch(es), Acceptable 0,00



Grill, Broken, E - Replace 0,00



Door R L, Bad repair, LI - Repair and paint (complete) 318,35

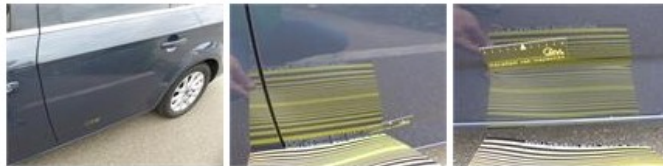

Door R R, Scratch(es), LI - Repair and paint (complete) 0,00



Rearview mirror housing R, Scratch(es), Acceptable 0,00



Windscreen, Stone chip(s), Acceptable 0,00



Wing F R, Bad repair, LI - Repair and paint (complete) 220,18



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

