


**OPEL Astra: 1HGR665**

Vinnnumber:	<b>WOLPE8E69E8069207</b>	Versionname:	<b>ASTRA BRE ecoFLEX Cosmo St/St 110PK</b>
First Registrationdate:	<b>16/07/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>84538</b>	Power Kw:	<b>81</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3213</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining semi-artificial leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>215/60/16/95 V Steel</b>			
Summer tyres:	Fr.L.	<b>Continental: 2 mm</b>	Fr.R.	<b>Continental: 2 mm</b>
	Re.L.	<b>Continental: 3 mm</b>	Re.R.	<b>Continental: 3 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	1591,68
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Seat cover F L, Damaged, Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20



Wing R R, Bad repair, Acceptable	0,00
----------------------------------	------




Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Outer backrest protection L, Damaged, Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 370,00

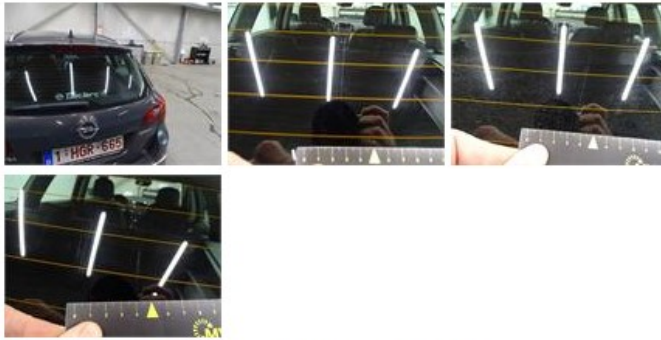

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80

