



VOLKSWAGEN Touran: 1FWW041			
Vinnnumber:	WVGZZZ1TZEW036260	Versionname:	TOURAN Trendline BMT Start/Stop 105PK
First Registrationdate:	21/11/2013	Fiscalpower:	
Expertise Mileage:	82882	Power Kw:	77
Bodytype:		Body color:	Light Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4830
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Luggage cover
Windows electric F	
Windows electric R	
Cruise Control	
Type of headlighting:	Headlighting Halogen
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control


Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	NOT OK

Degree of wear				
	195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			828,75
Interior, Dirty, Cleaning			0,00



Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------

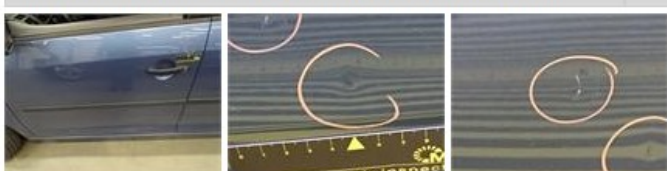



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 115,56



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Bumper grille F R, Scratch(es), E - Replace 32,40



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), Acceptable 0,00

No pictures to display

Rear wiper blade, Damaged, E - Replace 40,00



Rear bulkhead lining, Scratch(es), Smart repair 110,64



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00



