



CITROEN C5: 1EUJ466

Vinnnumber:	VF7RW9HD8DL506036	Versionname:	C5 TOURER e-HDi Bus.GPS
First Registrationdate:	22/03/2013	Fiscalpower:	Pl.BMP 113PK Aut
Expertise Mileage:	82080	Power Kw:	84
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3727
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/60/16/98 V LightMetal			
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	563,84
-------------------	--------

Rearview mirror housing R, Scratch(es), Acceptable	0,00
--	------

No pictures to display


Ceiling, Incomplete, E - Replace	33,60
----------------------------------	-------



Tailgate, Bump(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Boot carpet, Dirty, Chemical cleaning	50,00
---------------------------------------	-------

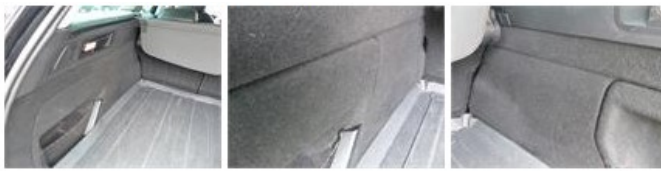

Front bumper, Scratch(es), It - Spot repair 115,56



Door F R, Bump(s), PDR - Knock out without painting 63,00



Tailgate, Rust, LI - Repair and paint (complete) 301,68



Wing F L, Bump(s), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display