


**RENAULT Master 33 L2H2: AP4914**

Vinnnumber:	<b>VF1FDB2H643438257</b>	Versionname:	<b>MASTER 33 B/F L2H2 Gr.Conf.101PK</b>
First Registrationdate:	<b>25/06/2010</b>	Fiscalpower:	
Expertise Mileage:	<b>240927</b>	Power Kw:	<b>74</b>
Bodytype:	<b>Transporter</b>	Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>LCV30</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>3</b>		
Number head rests:	<b>3</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Windows electric F		Central consol F	
Type of headlighting	<b>Headlighting Halogen</b>		
Type of Lining	<b>Lining fabrics</b>		

**Limited Technical Inspection**

Tires wear profile	<b>OK</b>	Battery functioning	<b>Yes</b>
Idle position	<b>OK</b>	Power steering	<b>Yes</b>
Engine startingtime	<b>OK</b>	Sound engine	<b>OK</b>
Exhaust gass	<b>OK</b>	Clutch test	<b>OK</b>
Handbrake	<b>OK</b>	Wiper fluid level	<b>OK</b>
		Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>215/65/16/107 R Steel</b>			
Winter tyres:	Fr.L.	<b>Kleber: 3 mm</b>	Fr.R.	<b>Kleber: 3 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	2232,27
Rearview mirror L complete, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover F L, Missing, E - Replace	22,50



Bonnet, Rust, LI - Repair and paint (complete)	217,56
--	--------











Trunk door R R, Damaged, Acceptable	0,00
-------------------------------------	------


*No pictures to display*

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

*No pictures to display*

Door F L, Bump(s) and scratch(es), Acceptable	0,00
---	------

<i>No pictures to display</i>	
Wheel cover F R, Missing, E - Replace	22,50
	
Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	327,15
	
	
Door R R, Repaired, Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	279,15
	
Front bumper, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Bump(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door panel F L, Damaged, E - Replace	29,80
	
Rocker panel inner F L, Damaged, E - Replace	34,60
	
Backrest cover F R, Stain, Acceptable	0,00
<i>No pictures to display</i>	
Wing trim R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Engine protective plate, Tear, E - Replace	89,00
	
Wing trim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Dashboard, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Rust, LI - Repair and paint (complete)	361,13
	

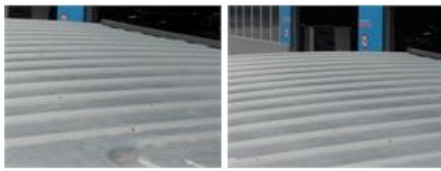

Seat cover F L, Tear, E - Replace

300,00



Bumper R, Strained , I - Repair

48,00



Sill outer R, Bump(s) and scratch(es), LI - Repair and paint (complete)

352,88



Door R R, Unclapsed, N - Mount/Dismount

0,00



Trunk door R L, Damaged, Acceptable

0,00

*No pictures to display*

Bumper corner R R, Scratch(es), E - Replace

148,00



Trunk lid covering R, Damaged, Acceptable

0,00

