



VOLKSWAGEN Golf: 1HBV875			
Vinnnumber:	WVWZZZAUZEW361046	Versionname:	GOLF BER Highline 105PK
First Registrationdate:	13/06/2014	Fiscalpower:	
Expertise Mileage:	179237	Power Kw:	77
Bodytype:		Body color:	Brown
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3308
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Sun Roof electric
Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Seats F heated	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining semi-leather
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK



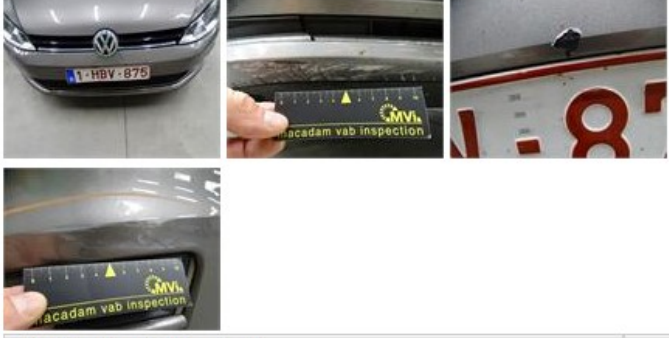
Degree of wear				
205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes

Total cost ex VAT	1950,98
Sill outer L, Bump(s) and scratch(es), Le - Replace and paint	712,00



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

<i>No pictures to display</i>		
Sill outer R, Bump(s) and scratch(es), Le - Replace and paint		712,00
		
Bonnet, Bump(s), Acceptable		0,00
<i>No pictures to display</i>		
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)		95,00
		
Wing R R, Bump(s), Acceptable		0,00
<i>No pictures to display</i>		
Front bumper, Scratch(es), LI - Repair and paint (complete)		211,80
		
Wing R L, Bump(s), Acceptable		0,00
<i>No pictures to display</i>		
Wing F R, Bump(s), LI - Repair and paint (complete)		220,18
