



MERCEDES CLA SHOOTING BRAKE: 1KHE782

Vinnumber:	WDD1179081N220179	Versionname:	2.1 CLA 200 CDI SHOOTING BRAKE
First Registrationdate:	5/05/2015	Fiscalpower:	
Expertise Mileage:	157413	Power Kw:	100
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1226
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining leather
Type of climate control:	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 8 mm	Re.R.	Uniroyal: 8 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2936,61
-------------------	---------


Wing R R, Bump(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------

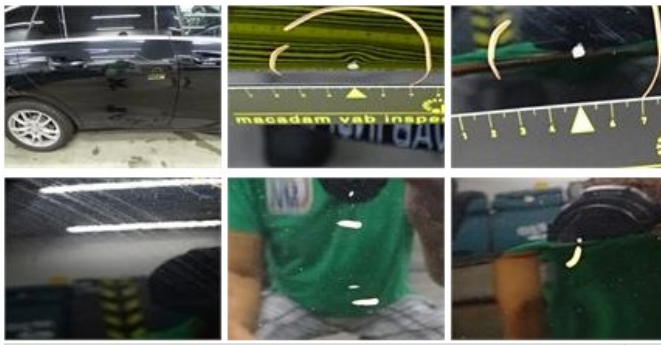

Headlight L, Damaged, E - Replace 396,00



Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Roof pillar L, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18



Brand badge, Missing, E - Replace 10,00



Bumper grille F L, Missing, E - Replace 32,40







Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Rearview mirror L complete, Damaged, Le - Replace and paint 283,00



Wing R L, Bump(s), Acceptable 0,00

Wing R L, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
	
Rocker panel inner R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rocker panel inner R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Front bumper, Damaged, Le - Replace and paint	735,00
	
	
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Side window trim F L, Bump(s) and scratch(es), E - Replace	50,00
	
Door R L, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	