



**TOYOTA AURIS: 1PHN986**

Vinnnumber:	<b>SB1MS3JE40E270363</b>	Versionname:	<b>1.8 HYBRID LOUNGE CVT AUTO</b>
First Registrationdate:	<b>7/07/2016</b>	Fiscalpower:	
Expertise Mileage:	<b>32135</b>	Power Kw:	<b>73</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Hybrid Petrol</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2506</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>Tow bar removable</b>
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining semi-leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/45/17/91 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Dunlop: 6 mm</b>	Fr.R.	<b>Dunlop: 6 mm</b>
	Re.L.	<b>Dunlop: 6 mm</b>	Re.R.	<b>Dunlop: 6 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	<b>1815,15</b>
Bumper R, Scratch(es), Acceptable	<b>0,00</b>




Roof, Hail damage, PDR - Hail	<b>750,00</b>
-------------------------------	---------------



Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80

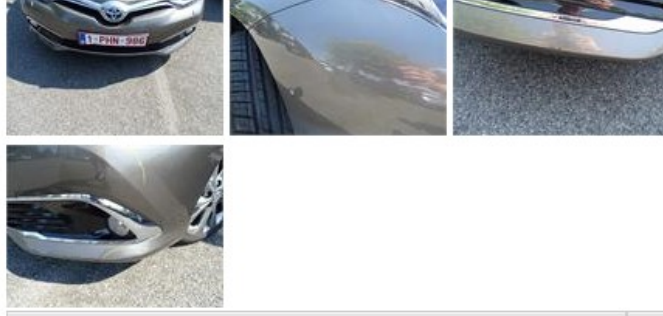

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Internal Boot Lining L, Scratch(es), Acceptable 0,00

No pictures to display

Internal Boot Lining R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Bump(s), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Hail damage, PDR - Hail 250,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), LI - Repair and paint (complete) 318,35



Door F R, Bump(s), Acceptable

0,00

*No pictures to display*