



TOYOTA Auris: 1FNT352

Vinnumber:	SB1KN3JE30E019218	Versionname:	AURIS BER ECO Comfort 90PK
First Registrationdate:	2/09/2013	Fiscalpower:	
Expertise Mileage:	77740	Power Kw:	66
Bodytype:	Hatchback	Body color:	Light Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2528
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Type of Tow bar	No Tow bar
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Bridgestone: 3 mm	Re.R.	Bridgestone: 3 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1992,35
-------------------	----------------

Bumper moulding F M, Crack, E - Replace	14,40
---	--------------



Bumper R, Crack, Le - Replace and paint	0,00
---	-------------





Front bumper, Dent(s) and scratch(es), Le - Replace and paint 0,00



Wheel cover F R, Scratch(es), E - Replace 30,00



Side window trim R L, Dent(s), Acceptable 0,00

No pictures to display

Sill outer L, Dent(s), LI - Repair and paint (complete) 310,50



Bumper moulding R L, Crack, E - Replace 14,40



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Roof pillar R, Dent(s), LI - Repair and paint (complete) 220,18



Sunblind R, Deformed / Strained, E - Replace 150,00



Side window trim F L, Dent(s), E - Replace 20,00



Interior, Dirty, Cleaning 50,00



Tailgate, Dent(s), LI - Repair and paint (complete) 301,68




Rearlight L, Broken, E - Replace 114,00



Roof, Hail damage, PDR - Hail 0,00



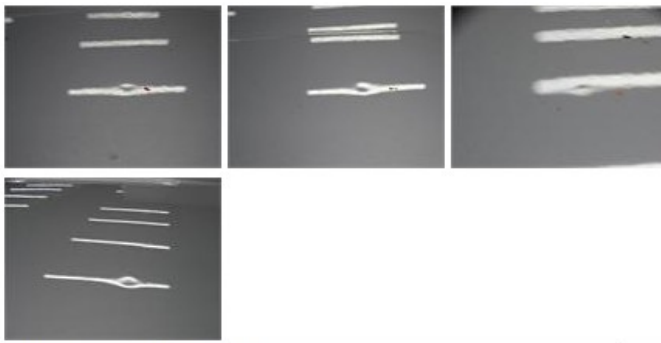

Bumper R, Scratch(es), Smart repair 110,64



Wheel cover F L, Scratch(es), E - Replace 30,00



Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Rear window, Scratch(es), E - Replace 0,00



Bonnet, Hail damage, PDR - Hail 0,00



