



BMW 3: 1HHG855

Vinnumber:	WBA3K11030F833670	Versionname:	3 TOURING 318d 136PK
First Registrationdate:	23/07/2014	Fiscalpower:	
Expertise Mileage:	122716	Power Kw:	100
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	BINNEN 6000KM	Parking lot:	4820
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/96 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Uniroyal: 7 mm	Re.R.	Uniroyal: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	973,80
-------------------	--------

Door F R, Dent(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------





Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s), PDR - Knock out without painting 63,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display


Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Roof, Dent(s), PDR - Knock out without painting 82,80



Sill outer R, Dent(s) and scratch(es), It - Spot repair 115,56

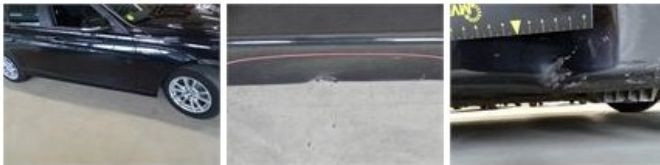

Bumper corner R L, Scratch(es), It - Spot repair 115,56



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

