


FORD Galaxy: 1GTU088

Vinnnumber:	WF0MXXGBWMEY20697	Versionname:	GALAXY Trend Style St/St
First Registrationdate:	28/04/2014	Fiscalpower:	DPF 115PK
Expertise Mileage:	64484	Power Kw:	85
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3504
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 2 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 3244,59

Wing R L, Bad repair, P - Check 0,00

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)
95,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 312,21



Luggage space cover, Scratch(es), E - Replace 288,00



Door F L, Dent(s), LI - Repair and paint (complete) 382,02



Door R L, Dent(s), It - Spot repair 115,56



Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Molding trunk, Dent(s), Smart repair 110,64



Wing R L, Dent(s), Acceptable 0,00



Sill outer R, Scratch(es), LI - Repair and paint (complete) 372,60

Oil Outer R, Scratch(es), LI - Repair and paint (complete) 572,00



Door panel F L, Scratch(es), Acceptable 0,00



Trunk lid covering R, Scratch(es), Smart repair 110,64



Roof, Chemical pollution, LI - Repair and paint (complete) 577,80



Bonnet, Scratch(es), 67 - Polish 0,00



Interior, Dirty, Cleaning 25,00




Rearview mirror housing R, Scratch(es), Acceptable 0,00



Wing F L, Dent(s), It - Spot repair 115,56



Door R L, Scratch(es), Acceptable 0,00

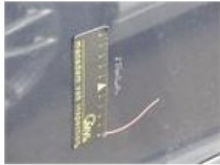

Door R R, Dent(s), It - Spot repair 115,56



Wing R R, Scratch(es), LI - Repair and paint (complete) 369,84

