



<b>BMW 1: LA6908</b>			
Vinnumber:	<b>WBA1C11010P530630</b>	Versionname:	<b>1 BER HATCH 118d 143PK</b>
First Registrationdate:	<b>2/12/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>105529</b>	Power Kw:	<b>105</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2522</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	<b>No Tow bar</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>NOT OK</b>

<b>Degree of wear</b>				
	<b>205/55/16/91 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Bridgestone: 4 mm</b>	Fr.R.	<b>Bridgestone: 4 mm</b>
	Re.L.	<b>Goodyear: 7 mm</b>	Re.R.	<b>Goodyear: 7 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
<b>Total cost ex VAT</b>			<b>1870,23</b>
<b>Alloy rim R R, Scratch(es), LI - Repair and paint (complete)</b>			<b>95,00</b>



<b>Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)</b>	<b>220,18</b>
--	---------------




<b>Bonnet, Chemical polution, 67 - Polish</b>	<b>0,00</b>
---	-------------

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Alloy rim F R, Scratch(es), E - Replace 235,20

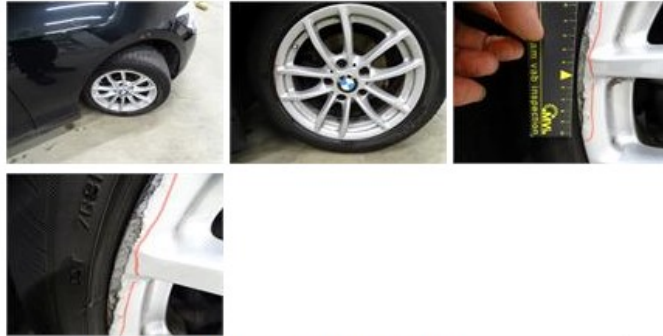

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 0,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display