



VOLVO V60: 1HAB045			
Vinnnumber:	<b>YV1FW31A1E1213531</b>	Versionname:	<b>V60 BRE D3 Kinetic 136PK</b>
First Registrationdate:	<b>2/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>157143</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Red</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1118</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	<b>Headlighting Halogen</b>
Type of GPS:	<b>GPS big screen color</b>
Type of Lining:	<b>Lining leather</b>

Limited Technical Inspection			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

Degree of wear				
	<b>215/55/16/97 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Continental: 1 mm</b>	Fr.R.	<b>Continental: 1 mm</b>
	Re.L.	<b>Continental: 3 mm</b>	Re.R.	<b>Continental: 3 mm</b>






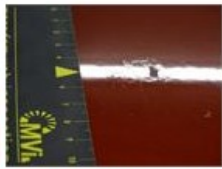









Assistance equipment	
Total cost ex VAT	2977,44
Bonnet, Chemical polution, Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Scratch(es), LI - Repair and paint (complete)	318,35



Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Door F L, Scratch(es), LI - Repair and paint (complete)	318,35
---	--------

			
Wing F L, Scratch(es), LI - Repair and paint (complete)			220,18
			
Roof, Chemical pollution, LI - Repair and paint (complete)			481,50
			
Wing F R, Scratch(es), LI - Repair and paint (complete)			220,18
			
Alloy rim F R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Rear window, Scratch(es), E - Replace			370,00
			
Tyre repair kit, Missing, E - Replace			210,53
			
Wing R R, Scratch(es), LI - Repair and paint (complete)			308,20
			
Door R R, Scratch(es), LI - Repair and paint (complete)			318,35
