



MERCEDES A: 1HJK312

Vinnumber:	WDD1760121V020580	Versionname:	A 180CDI BE Edition 109PK
First Registrationdate:	1/08/2014	Fiscalpower:	
Expertise Mileage:	88838	Power Kw:	80
Bodytype:	Hatchback	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3716
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/95 V Steel			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Spare wheel	Yes
Repair kit	Yes

Total cost ex VAT	2170,00
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80



Wing R R, Scratch(es), LI - Repair and paint (complete)	308,20
--	---------------



Windscreen, Repaired, Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 30,00




Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace 30,00



Sill outer R, Scratch(es), LI - Repair and paint (complete) 310,50

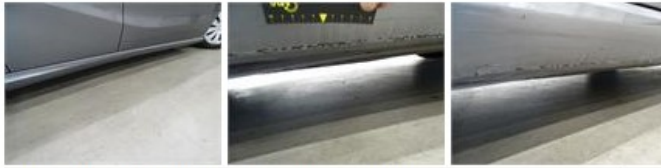

Bonnet, Dent(s), PDR - Knock out without painting 63,00



Bumper F, Crack, Le - Replace and paint 735,00



Roof, Dent(s), LI - Repair and paint (complete) 481,50

