



VOLKSWAGEN Passat: 1HJS155

Vinnnumber:	WVWZZZ3CZFE028407	Versionname:	PASSAT VAR Trendline BM
First Registrationdate:	4/08/2014	Fiscalpower:	105PK
Expertise Mileage:	52298	Power Kw:	77
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2820
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H Steel			
Summer tyres:	Fr.L.	Dunlop: 4 mm	Fr.R.	Dunlop: 4 mm
	Re.L.	Dunlop: 7 mm	Re.R.	Dunlop: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------


Total cost ex VAT	1347,21
-------------------	---------

Roof, Dent(s), Acceptable	0,00
---------------------------	------


No pictures to display

Bonnet, Dent(s), PDR - Knock out without painting	82,80
---	-------



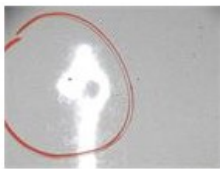

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

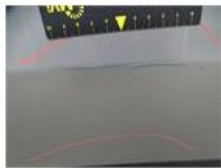

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Sill outer R, Scratch(es), LI - Repair and paint (complete) 310,50



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Roof pillar R, Dent(s), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

