


MERCEDES C: 1G1S046

Vinnnumber:	WDD2042021G284618	Versionname:	C BRE 220CDI BE Edition Avantgarde 163PK
First Registrationdate:	18/02/2014	Fiscalpower:	
Expertise Mileage:	93037	Power Kw:	120
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3704
Maintenance:	SERVICEBEURT A OVER 15500KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	HD	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Type of headlighting:	Headlighting Halogen	
Type of GPS:	GPS big screen color	
Type of Lining:	Lining semi-artificial leather	
Type of climate control:	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT 1406,99

Door R L, Dent(s) and scratch(es), Acceptable 0,00


No pictures to display
Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80




Bumper moulding R L, Broken, E - Replace 14,40



Bonnet, Hail damage, PDR - Hail 250,00

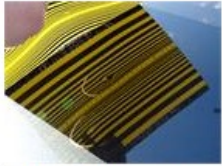

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Roof, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door panel R L, Tear, Smart repair 110,64



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Stain, Cleaning 100,00



Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display