



BMW 5: 1HSK674

Vinnumber:	WBA5L11000D968672	Versionname:	5 TOURING 518dA 136PK Aut.
First Registrationdate:	22/09/2014	Fiscalpower:	
Expertise Mileage:	91065	Power Kw:	100
Bodytype:	Break	Body color:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4714
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage	HD	Panoramic roof	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	Tow bar fixed
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	245/45/18/96 Y LightMetal			
Summer tyres:	Fr.L.	Dunlop: 4 mm	Fr.R.	Dunlop: 4 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

	Runflat	Yes
--	---------	------------

Total cost ex VAT	2736,24
-------------------	----------------

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	--------------



Sill outer L, Scratch(es), LI - Repair and paint (complete)	0,00
---	-------------



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 417,84



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00




Door R R, Scratch(es), LI - Repair and paint (complete) 0,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 478,02

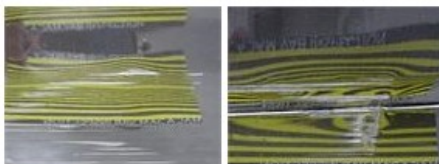

Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 458,02



Reflector, Broken, E - Replace 0,00



Rearview mirror R complete, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Tyre F R, Tear, E - Replace 153,60



Door F R, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 326,16



Sill outer R, Scratch(es), LI - Repair and paint (complete) 372,60



Ignition key, Missing, E - Replace 150,00



Bumper R, Deformed / Strained, Le - Replace and paint 0,00

