



VOLVO V60: 1KDS132

Vinnumber:	YV1FW8481F1268809	Versionname:	1.6 D2 MOMENTUM
First Registrationdate:	9/04/2015	Fiscalpower:	
Expertise Mileage:	37051	Power Kw:	84
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4608
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	215/50/17/95 W LightMetal			
	Fr.L.	Michelin: 2,5 mm	Fr.R.	Michelin: 2,5 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1802,86
Wing F R, Dent(s), PDR - Paintless dent repair	63,00




Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Wing F L, Dent(s), PDR - Paintless dent repair

63,00

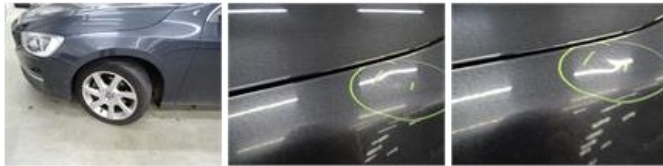

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R L, Dent(s), PDR - Paintless dent repair

63,00



Bonnet, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Door F L, Scratch(es), It - Spot repair

115,56



Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80

