



<b>BMW 3: 1FIQ648</b>			
Vinnumber:	<b>WBA3K11020F825754</b>	Versionname:	<b>3 TOURING 318d 136PK</b>
First Registrationdate:	<b>9/07/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>109643</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3202</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>			
Radio CD		Sun Roof electric	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining artificial leather</b>		
Type of climate control	<b>Autom climate control</b>		

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

<b>Degree of wear</b>				
	<b>205/60/16/96 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Goodyear: 6 mm</b>	Fr.R.	<b>Goodyear: 6 mm</b>
	Re.L.	<b>Goodyear: 6 mm</b>	Re.R.	<b>Goodyear: 6 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
<b>Total cost ex VAT</b>			<b>2784,92</b>
<b>Rearview mirror housing R, Scratch(es), Smart repair</b>			<b>110,64</b>





Door F R, Scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Roof, Chemical pollution, LI - Repair and paint (complete)

481,50




Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

290,08

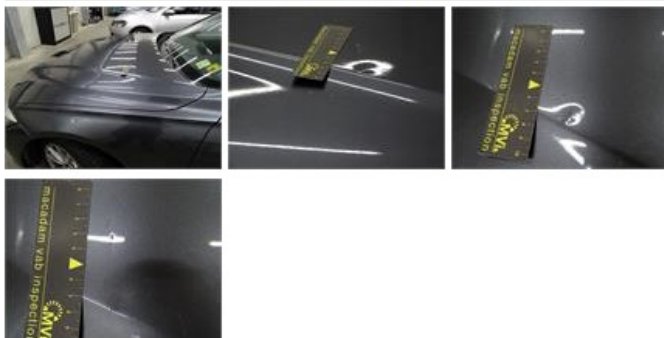

Bumper R, Dent(s) and scratch(es), Le - Replace and paint

651,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80

