



**BMW 3 TOURING: 1JFV985**

Vinnumber:	<b>WBA3L11050K258489</b>	Versionname:	<b>2.0 320D EFFICIENTDYN. (120KW) TOURING</b>
First Registrationdate:	<b>6/12/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>89370</b>	Power Kw:	<b>120</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Blue</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2102</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Radio multimedia	Rear parking sensors
Type of headlighting	Type of Tow bar
Type of GPS	<b>Headlighting Halogen</b>
Type of Lining	<b>GPS big screen color</b>
Type of climate control	<b>Lining leather</b>
	<b>Autom climate control</b>
	<b>No Tow bar</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

	<b>205/60/16/92 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Kleber: 6 mm</b>	Fr.R.	<b>Kleber: 6 mm</b>
	Re.L.	<b>Kleber: 5 mm</b>	Re.R.	<b>Kleber: 5 mm</b>

**Assistance equipment**


Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

<b>Total cost ex VAT</b>	<b>1151,15</b>
<b>Door R R, Scratch(es), LI - Repair and paint (complete)</b>	<b>318,35</b>

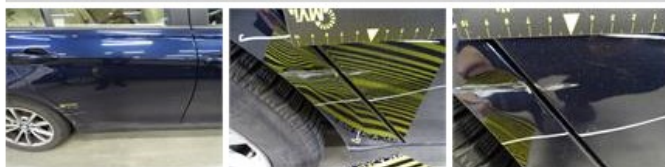

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00

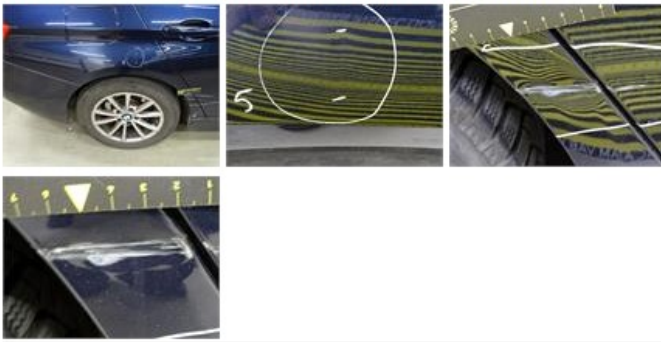


Sill outer L, Deformed / Strained, LI - Repair and paint (complete)

310,50



Sill outer R, Deformed / Strained, LI - Repair and paint (complete)

310,50

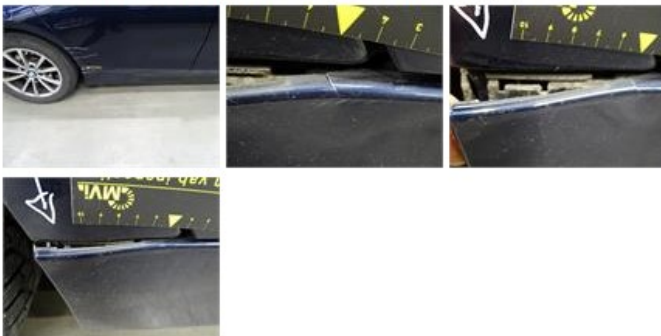

Seat cover F L, Worn, Acceptable

0,00



Bonnet, Scratch(es), 67 - Polish

0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80





Door F L, Scratch(es), Acceptable

0,00

*No pictures to display*