



BMW SERIE 3 TOURING: 1HXP033

Vinnumber:	WBA3K91080F936453	Versionname:	316D
First Registrationdate:	22/10/2014	Fiscalpower:	
Expertise Mileage:	115314	Power Kw:	85
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	IN 3600 KM	Parking lot:	3414
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Type of Tow bar	Tow bar fixed
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	4393,82
Tailgate, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Dent(s), PDR - Paintless dent repair	82,80



Roof rail L, Deformed / Strained, E - Replace

188,84



Roof pillar R, Scratch(es), LI - Repair and paint (complete)

220,18



Seat cover F L, Worn, P - Check

0,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R R, Scratch(es), Acceptable

0,00

No pictures to display


Door panel trim R L, Scratch(es), E - Replace

114,00



Windscreen, Stone chip(s), E - Replace

487,20

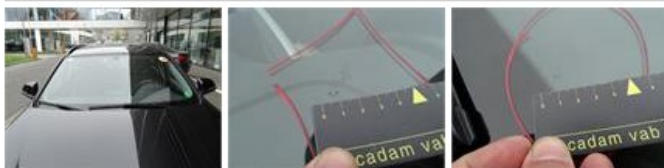

Wing R R, Dent(s), PDR - Paintless dent repair

63,00



Door F L, Deformed / Strained, LI - Repair and paint (complete)

366,35



Rearview mirror basis L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s) and scratch(es), LI - Repair and paint (complete) 529,50



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Interior, Not original part, E - Replace 95,20



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Roof rail R, Deformed / Strained, E - Replace 188,84



Door frame F L, Deformed / Strained, Repair/replace (lump sum) 36,83




Door panel F R, Hole, E - Replace 114,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35

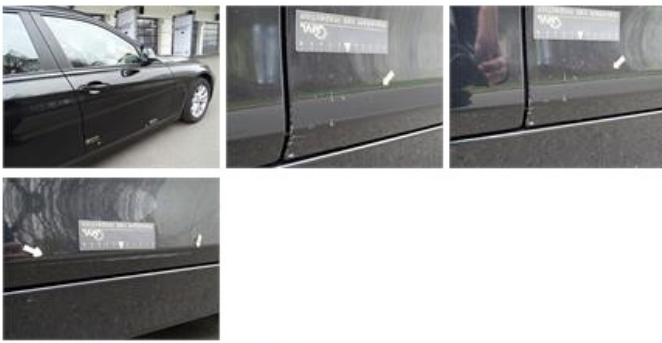

Door panel R L, Hole, E - Replace 114,00



Headlight L, Scratch(es), E - Replace 396,00



Headlight R, Scratch(es), E - Replace 396,00



Interior, Dirty, Cleaning 152,58

