



VOLKSWAGEN Golf: 1ERM202

Vinnumber:	WVWZZZAUZDW091450	Versionname:	GOLF BER Highline 105PK
First Registrationdate:	1/03/2013	Fiscalpower:	
Expertise Mileage:	61240	Power Kw:	77
Bodytype:		Body color:	Blue
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3422
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

GPS storage	SD	Sun Roof electric
GPS storage		Central consol F
Windows electric F		Luggage cover
Windows electric R		Front parking sensors
Cruise Control		Rear parking sensors
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining artificial leather	
Type of climate control	Manual climate control	
Adaptive cruise control		
Sport seats		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/45/17/91 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment

Total cost ex VAT	3193,78
Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)	115,56



Door F R, Bad repair, LI - Repair and paint (complete)

318,35



Wing F R, Scratch(es), LI - Repair and paint (complete)

220,18



Door R L, Dent(s), Acceptable

0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00




Rearview mirror housing R, Scratch(es), Paint

30,00




Seat cover R, Stain, Cleaning

25,00

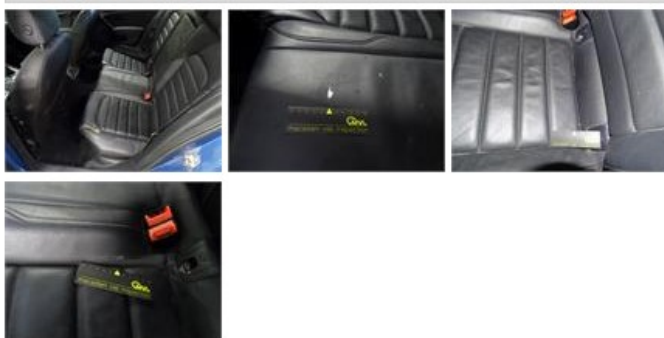

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

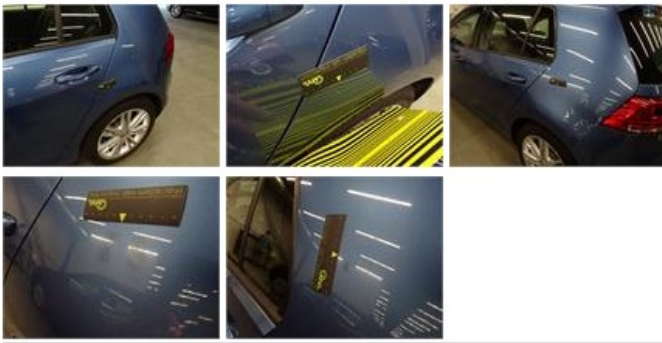

Bonnet, Dent(s), LI - Repair and paint (complete)

386,08



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56



Sill outer L, Dent(s), LI - Repair and paint (complete)

406,50



Wheel arch cover F L, Broken, E - Replace

45,00




Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00

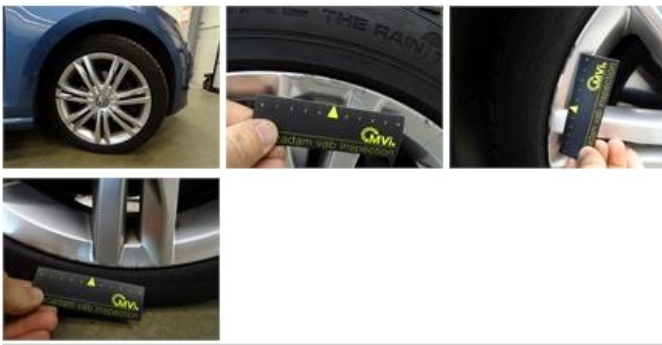

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Interior, Dirty, Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Steering wheel, Worn, Acceptable 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Sill outer R, Bad repair, LI - Repair and paint (partial)

100,00

