



**NISSAN Qashqai: 1GTK339**

Vinnumber:	<b>SJNFAAJ11U1070729</b>	Versionname:	<b>QASHQAI 2WD Business Ed.110PK</b>
First Registrationdate:	<b>24/04/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>135589</b>	Power Kw:	<b>81</b>
Bodytype:	<b>SUV</b>	Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2422</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>215/60/17/96 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Vredestein: 6 mm</b>	Fr.R.	<b>Vredestein: 6 mm</b>
	Re.L.	<b>Vredestein: 7 mm</b>	Re.R.	<b>Vredestein: 7 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	<b>2559,84</b>
Bumper R, Scratch(es), LI - Repair and paint (complete)	<b>211,80</b>





Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Bumper F, Scratch(es), Smart repair

110,64



Alloy rim F R, Deformed / Strained, E - Replace

235,20



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56



Wing F L, Scratch(es), Acceptable

0,00

*No pictures to display*

Bumper R, Dent(s) and scratch(es), Smart repair

110,64







Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08




Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

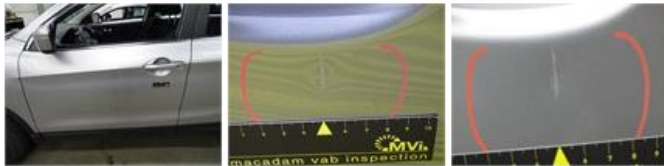

Wing R R, Scratch(es), It - Spot repair 0,00



Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Door moulding Lower R R, Scratch(es), E - Replace 0,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

