


PEUGEOT 2008: 1HLF977

Vinnumber:	VF3CU9HP0EY085944	Versionname:	2008 e-HDi Allure 92PK
First Registrationdate:	19/08/2014	Fiscalpower:	
Expertise Mileage:	84460	Power Kw:	68
Bodytype:	SUV	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3125
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	195/60/16/89 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1666,46
Bonnet, Chemical pollution, LI - Repair and paint (complete)	290,08

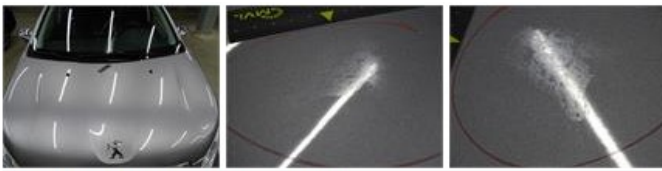

Mirror side blinker R, Broken, E - Replace

30,00



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door R R, Scratch(es), 67 - Polish 0,00



Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Bumper R, Scratch(es), Smart repair 110,64





Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Rear roof pillar covering L, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Trunk lid covering R, Scratch(es), Acceptable

0,00

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18

