



VOLKSWAGEN Crafter 35 LWB HR: 1CC1822

Vinnumber:	WV1ZZZ2EZB6023687	Versionname:	CRAFTER 35 B/F2C LWB HR 109PK
First Registrationdate:	18/10/2011	Fiscalpower:	
Expertise Mileage:	156368	Power Kw:	80
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	TRU20
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Type of Tow bar	Tow bar fixed
Windows electric F		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining artificial leather	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/16/115 R Steel				
Summer tyres:	Fr.L.	Pirelli: 6 mm	Fr.R.	Pirelli: 6 mm
	Re.L.	Michelin: 8 mm	Re.R.	Michelin: 8 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	2577,93
-------------------	----------------

Bumper R, Deformed / Strained, E - Replace	329,40
--	---------------





Door F R, Dent(s), PDR - Paintless dent repair

63,00



Trunk door R L, Dent(s) and scratch(es), It - Spot repair

115,56



Door moulding Lower R R, Scratch(es), E - Replace

91,50



Seat cover F R, Hole, Smart repair

64,32



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Bonnet, Stone chip(s), Acceptable

0,00

No pictures to display


Door R L, Rust, LI - Repair and paint (complete)

238,76



Trunk door R R, Dent(s) and scratch(es), It - Spot repair

115,56

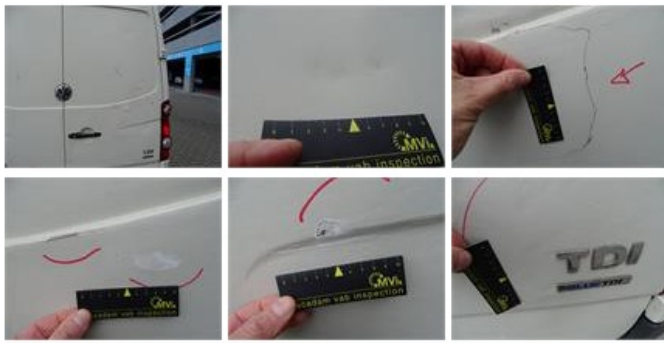

Sill outer L, Rust, LI - Repair and paint (complete)

232,88



Instruction book, Missing, E - Replace

0,00

No pictures to display

Trunk door panel L, Scratch(es), Smart repair

134,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Rearview mirror housing L, Broken, E - Replace

74,00



Door R R, Dent(s), Acceptable

0,00

No pictures to display

Interior, Dirty, Cleaning

0,00



Sill outer R, Rust, LI - Repair and paint (complete)

232,88



Trunk door panel R, Broken, E - Replace

74,00



Wing F R, Scratch(es), LI - Repair and paint (complete)

165,13



Rearview mirror housing R, Broken, E - Replace

74,00



Windscreen, Stone chip(s), Acceptable

0,00



Bumper F, Dent(s) and scratch(es), Smart repair

110,64

