


RENAULT Megane: 1GIK798

Vinnumber:	VF1KZ140650394661	Versionname:	MEGANE BRE Energy TomTom Ed.110PK
First Registrationdate:	17/02/2014	Fiscalpower:	
Expertise Mileage:	137653	Power Kw:	81
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4408
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 T Steel			
Winter tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2933,12
-------------------	---------

Wheel cover F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Windscreen, Stone chip(s), Acceptable	0,00
---------------------------------------	------

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Bonnet, Chemical pollution, LI - Repair and paint (complete)

290,08




Bumper F, Scratch(es), Acceptable

0,00

No pictures to display


Roof, Hail damage, PDR - Hail

375,00

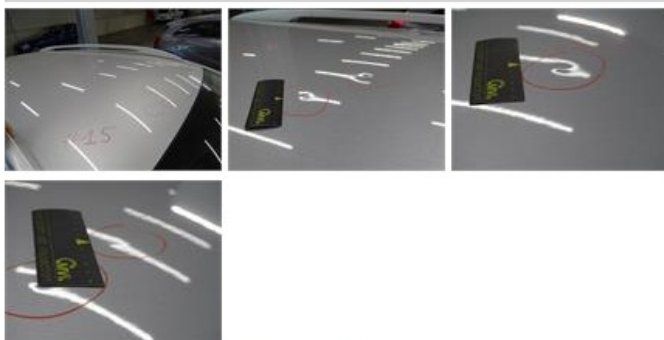

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35

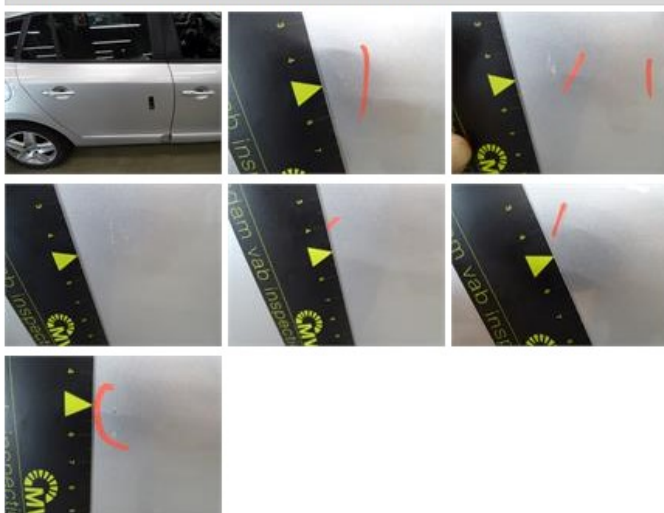

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Wheel cover F L, Broken, E - Replace

30,00



Bumper corner R L, Scratch(es), It - Spot repair

115,56



Bumper corner R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper cover R M, Scratch(es), Acceptable

0,00

No pictures to display

Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Rearlight L, Broken, E - Replace

114,00




Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

268,18



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

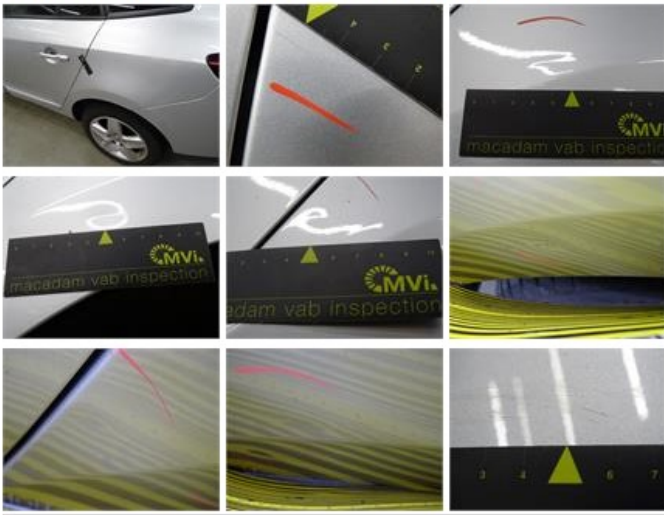

Windscreen, Stone chip(s), E - Replace

487,20

