



VOLKSWAGEN Sharan: 1GWN850

Vinnumber:	WVWZZZ7NZEV040280	Versionname:	SHARAN Comfortline BMT 136PK
First Registrationdate:	20/05/2014	Fiscalpower:	
Expertise Mileage:	160341	Power Kw:	100
Bodytype:		Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2129
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

215/60/16/95 H LightMetal				
Summer tyres:	Fr.L.	Continental: 7 mm	Fr.R.	Continental: 7 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	4420,12
Alloy rim R L, Rust, Acceptable	0,00
<i>No pictures to display</i>	
Roof pillar R, Dent(s) and scratch(es), LI - Repair and paint (complete)	264,22

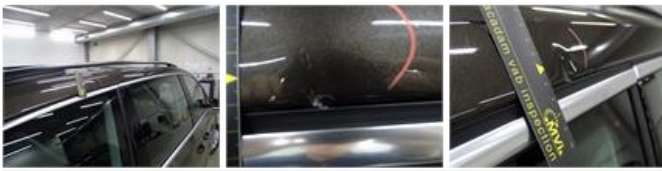

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Protection plate M, Hole, E - Replace

74,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02





Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F L, Scratch(es), LI - Repair and paint (complete)

264,21



Alloy rim F L, Rust, Acceptable

0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02





Roof, Chemical polution, LI - Repair and paint (complete) 577,80



Windscreen, Stone chip(s), Acceptable 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Internal Boot Lining L, Broken, E - Replace 30,00




Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02

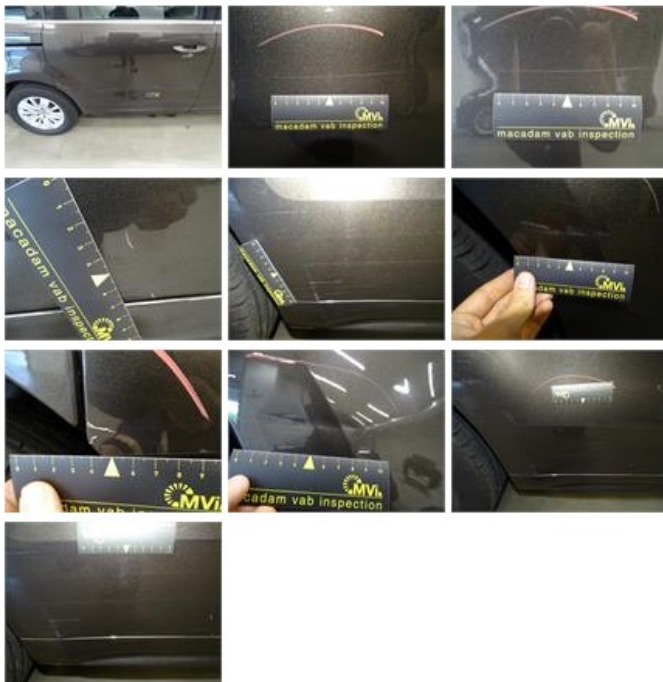

Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

369,84



Ignition key, Broken, E - Replace

150,00



Bonnet, Stone chip(s), LI - Repair and paint (complete)

348,09

