



VOLKSWAGEN Polo: 1FPQ746

Vinnumber:	WVWZZZ6RZEY059773	Versionname:	POLO Trendline DPF 75PK
First Registrationdate:	17/09/2013	Fiscalpower:	
Expertise Mileage:	57684	Power Kw:	55
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3606
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
Windows electric F		Luggage cover	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	175/70/14/88 T Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Dunlop: 5 mm	Re.R.	Dunlop: 5 mm


Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 1714,26


Bonnet, Chemical polution, LI - Repair and paint (complete) 256,06



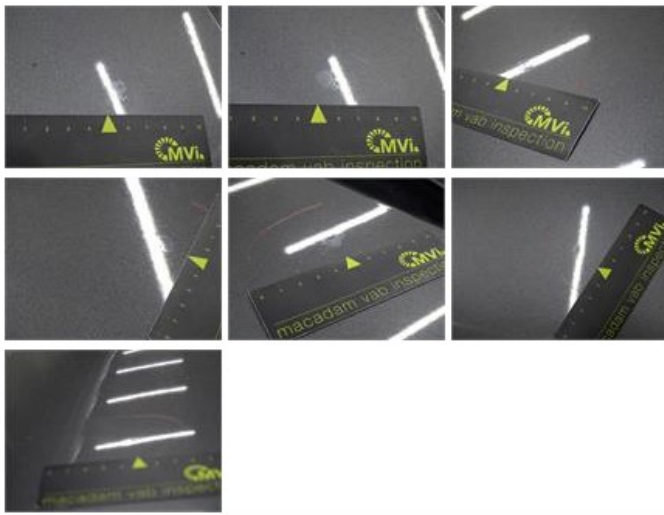

Windscreen, Stone chip(s), E - Replace

0,00

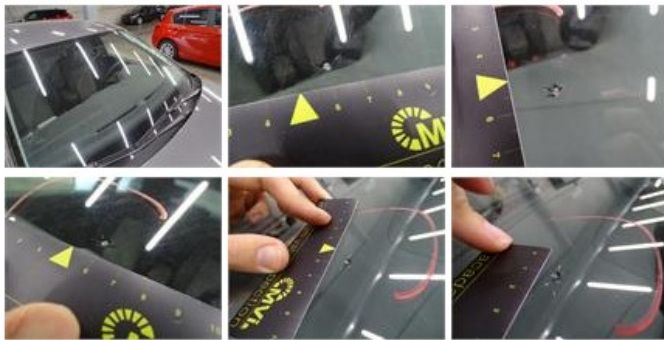

Interior, Dirty, Cleaning

25,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

169,44



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

169,44



Roof, Chemical polition, LI - Repair and paint (complete)

433,20



Wheel cover F R, Scratch(es), E - Replace

24,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

246,56



Rearview mirror basis L, Broken, E - Replace

144,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 246,56



Door F L, Scratch(es), Acceptable 0,00

No pictures to display