



VOLKSWAGEN GOLF VII: 1LUY217

| | | | |
|------------------------------------|--------------------------|--------------|-------------------------------|
| Vinnumber: | WVWZZZAUZGP061651 | Versionname: | 1.6 TDI 81KW TRENDLINE |
| First Registrationdate: | 11/12/2015 | Fiscalpower: | |
| Expertise Mileage: | 179513 | Power Kw: | 81 |
| Bodytype: | | Body color: | Black |
| Gearbox: | MAN 5 VIT | Paint type: | Metalic |
| Transmission: | Front | Rims summer: | Steel |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 2332 |
| Number of doors: | 5 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Steel | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | |
|--------------------------------|------------------------------|
| Windows electric F | Central consol F |
| Windows electric R | Luggage cover |
| Cruise Control | Front parking sensors |
| Steering wheel multifunctional | Rear parking sensors |
| Radio multimedia | Type of Tow bar |
| Type of headlighting | Headlighting Halogen |
| Type of GPS | GPS big screen color |
| Type of Lining | Lining fabrics |
| Type of climate control | Autom climate control |
| Adaptive cruise control | Tow bar fixed |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |


Degree of wear

| | | | | |
|---------------|-----------------------------|-----------------------|-------|-----------------------|
| | 195/65/15/91 T Steel | | | |
| Winter tyres: | Fr.L. | Goodyear: 4 mm | Fr.R. | Goodyear: 4 mm |
| | Re.L. | Goodyear: 4 mm | Re.R. | Goodyear: 4 mm |

Assistance equipment

| | | | |
|--|------------|------|------------|
| Emergency spare wheel | Yes | Jack | Yes |
| Number of charging cables (normal) | 0 | | |
| Number of charging cables (rapid charge) | 0 | | |

| | |
|---|---------|
| Total cost ex VAT | 2019,15 |
| Bumper R, Crack, Le - Replace and paint | 651,00 |

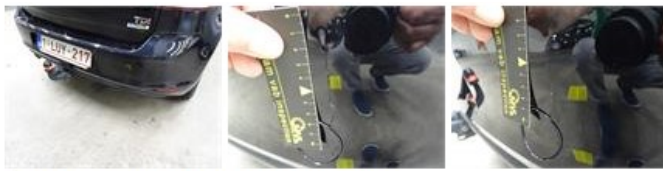

Wing R R, Dent(s), PDR - Paintless dent repair

63,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

481,50



Wing F R, Dent(s), Acceptable

0,00

No pictures to display

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Tailgate, Dent(s), Acceptable

0,00

No pictures to display

Rear spoiler, Dent(s) and scratch(es), LI - Repair and paint (complete)

115,56



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18



Bumper F, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Reflector, Broken, E - Replace

54,00



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Bonnet, Dent(s), Acceptable

0,00

No pictures to display