



OPEL Astra: 1GHM382

Vinnumber:	WOLPD8EW7E8029629	Versionname:	ASTRA BRE ecoFLEX Business 110PK
First Registrationdate:	10/02/2014	Fiscalpower:	
Expertise Mileage:	158435	Power Kw:	81
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1213
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage	HD	Rear parking sensors	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


215/60/16/95 V Steel				
Summer tyres:	Fr.L.	Hankook: 2 mm	Fr.R.	Hankook: 2 mm
	Re.L.	Hankook: 5 mm	Re.R.	Hankook: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 1914,15

Rear window, Scratch(es), Acceptable 0,00

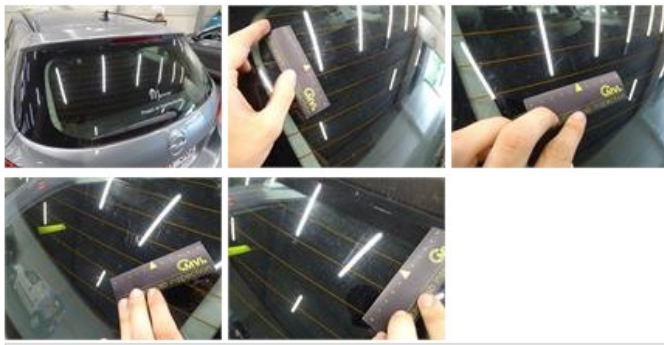

Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar L, Chemical polution, LI - Repair and paint (complete) 220,18



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Boot carpet, Hole, E - Replace 100,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56





Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper moulding R, Scratch(es), Acceptable

0,00

No pictures to display


Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

290,08

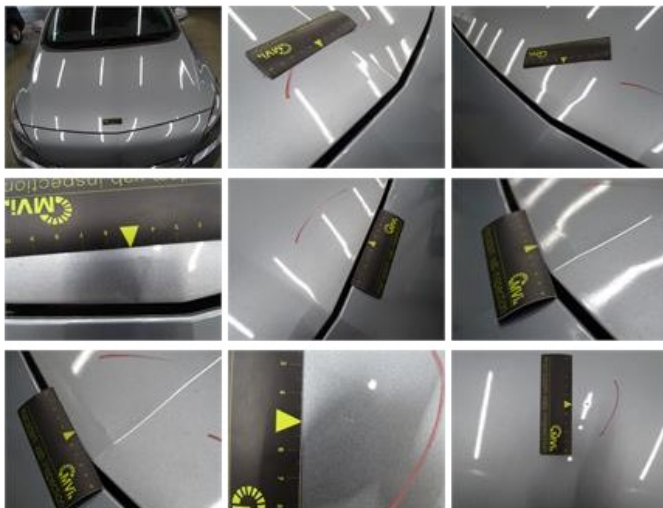

Trunk lid covering R, Scratch(es), Smart repair

110,64



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Door R L, Scratch(es), LI - Repair and paint (complete)

