



BMW 5: 1HYP423			
Vinnumber:	WBA5E31010D786548	Versionname:	5 BER 518dA 136PK Aut.
First Registrationdate:	30/10/2014	Fiscalpower:	
Expertise Mileage:	159952	Power Kw:	100
Bodytype:	Berline	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3116
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
Radio CD		Central consol F	
GPS storage		Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/55/17/97 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	856,32
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00



Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00




Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), PDR - Paintless dent repair 63,00

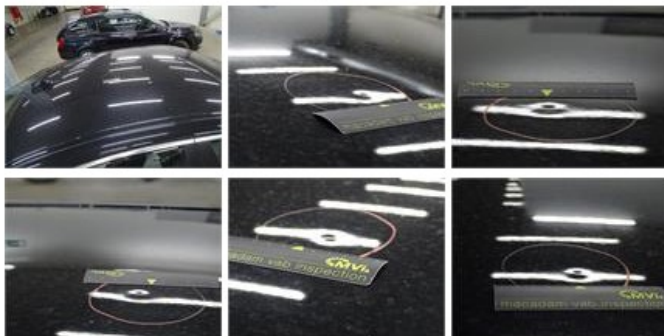

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Wing F L, Bad repair, Acceptable 0,00



Door R R, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16

